

1571 S 8th St. Cottage Grove, OR 97424

(541)649-8100

ervinfamilypumpservice@gmail.com

Flow Test Results

Prepared for Keith Wolf

Property Address: 25498 Butler Rd.


Junction City OR 97448

Date of Flow test: 4/23/25

Start Time: 9:15am

Test Performed By: Asia Ervin

INTERVAL	TIME	GPM
Start	9:15	9.5
15m	9:30	9
30m	9:45	6
45m	10:00	8.5
Hour 1	10:15	8.5
15m	10:30	5
30m	10:45	5
45m	11:00	5
Hour 2	11:15	5
15m	11:30	5
30m	11:45	5
45m	12:00	5
Hour 3	12:15	5
15m	12:30	5
30m	12:45	5
45m	1:00	5
Finish	1:15	5

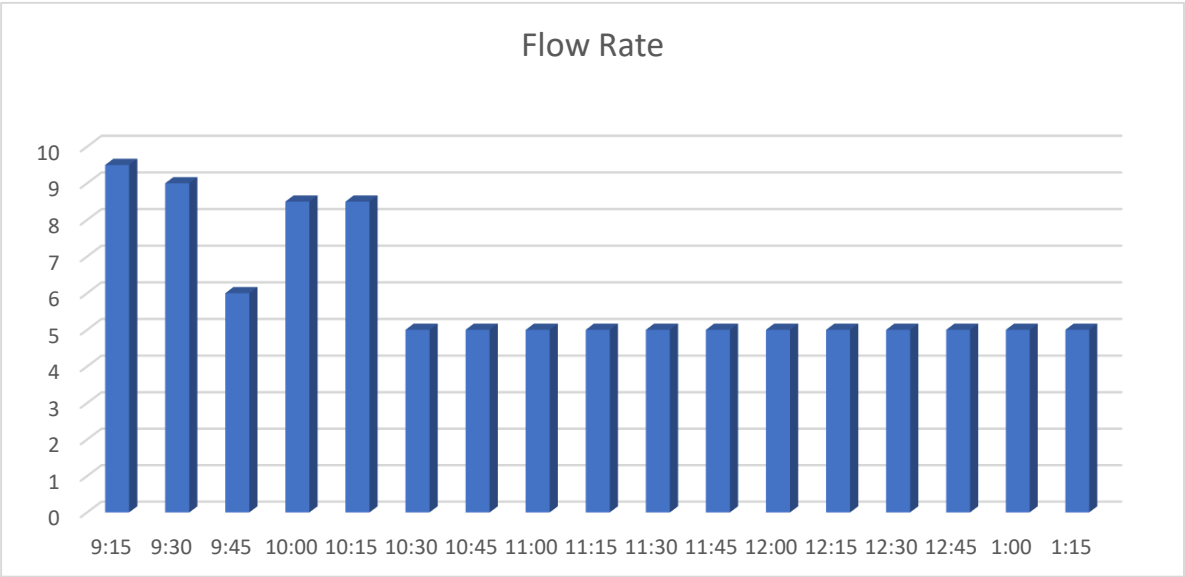

Comments

The well has met the minimum state requirement of 5 GPM for a 4 HR. period.

AVERAGE FLOW RATE: 5

Flow Restrictor Used: YES

Water Quality Test Collected: Yes

Arsenic____X____ Nitrate __X__ Bacteria/ E. Coli____X____

OTHER COMMENTS:

After running the well for 30 minutes for an hour, the well ran out of water. The pump kicked off. After two minutes. The pump automatically kicked on and water ran at 9 GPM again. I hooked up a flow restrictor, and the well sustained. This tells me that the pump is pushing too much water for what the well can produce. Under normal use, there should not be a problem. Only stress testing pushed it.

Thank You For Choosing EFPS!

Due to the variable nature of wells and pumps, the information stated herein is representative of conditions at the time of service ONLY.